


LX9FH2202

TeSys F-spec. zavojnica sklopnika-220... 230 V AC
40... 400 Hz niska potrošnja

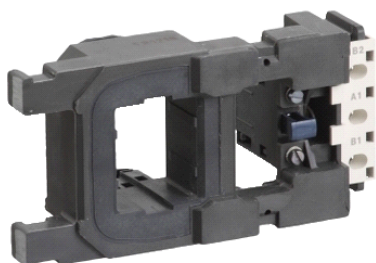

Glavno

Range	TeSys
Product or component type	Specific contactor coil
Device short name	LX9FH
Range compatibility	TeSys F LC1F contactor
Product compatibility	LC1F265 LC1F330
Control circuit type	AC 40...400 Hz low consumption
[Uc] control circuit voltage	220...230 V AC 40...400 Hz
Average resistance	71.6 Ohm inrush at 20 °C 1621 Ohm holding at 20 °C
Operating time	25 ms opening 45 ms closing
Mechanical durability	10 Mcycles
Operating rate	<= 3600 cyc/h at <= 55 °C

Komplementarno

Coil technology	Without built-in suppressor module
Control circuit voltage limits	0.85...1.1 Uc at 55 °C operational 0.35...0.55 Uc at 55 °C drop-out
Inrush power in VA	560...660 VA at 20 °C 40...400 Hz
Hold-in power consumption in VA	8...10 VA at 20 °C 40...400 Hz
Heat dissipation	8.4...10.4 W

Okolina

ambient air temperature for operation	-5...55 °C
product weight	0.75 kg

Offer Sustainability

Green Premium product	Green Premium product
Compliant - since 0915 - Schneider Electric declaration of conformity	Compliant - since 0915 - Schneider Electric declaration of conformity
Reference not containing SVHC above the threshold	Reference not containing SVHC above the threshold
Available	Available
Available	Available

Contractual warranty

Warranty period	18 months
-----------------	-----------

Informacije dane u ovoj dokumentaciji sadrže opće opise i/ili tehničke karakteristike o performansama ovdje sadržanih proizvoda. Ova dokumentacija nije namijenjena kao zamjena za niti bi se trebala koristiti za određivanje prikladnosti ili pouzdanosti predmetnih proizvoda za konkretne korisničke primjene. Svaki takav korisnik ili integrator dužan je provesti odgovarajuću i poipunu analizu rizika, procjenu i ispitivanje proizvoda u odnosu na odgovarajuću specifičnu primjenu ili uporabu istog. Niti društvo Schneider Electric Industries SAS niti bilo koje od njegovih povezanih poduzeća ili podružnica neće preuzeti obvezu ili snositi odgovornost za pogrešnu upotrebu ovdje sadržanih informacija.